APEX RESTORATION CO.

4800 Blake St, Suite 200, Denver, CO 80216

(720) 555-0100 | c.martinez@email.com

DAILY DRYING REPORT

Job #JOB-2024-0847 | March 23, 2026 | Day 3 of 5

Job #JOB-2024-0847 | Generated March 25, 2026

3	11	3	7	Active
AREAS AFFECTED	MOISTURE PTS.	CURRENT DAY	EQUIP. ACTIVE	JOB STATUS

Ambient Conditions

Day	Date	Temp (F)	Humidity (%)	Dew Point	GPP	Notes
Day 3	Mar 23	74F	48%	53F	63	--

Moisture Readings by Area

Master Bathroom

Location	Material	Day 1	Day 2	Day 3	Change
Subfloor (N wall cavity)	Subfloor OSB	24.1%	18.4%	12.2%	-11.9%
Drywall base - N wall	Drywall	19.6%	14.1%	9.3%	-10.3%
Drywall base - E wall	Drywall	22.3%	16.8%	11.0%	-11.3%
Subfloor center	Subfloor OSB	20.7%	15.2%	9.8%	-10.9%

Hallway

Location	Material	Day 1	Day 2	Day 3	Change
Flooring - N section	Hardwood	17.2%	12.6%	8.4%	-8.8%
Flooring - S section	Hardwood	14.8%	10.9%	7.2%	-7.6%
Drywall base - W wall	Drywall	11.3%	8.7%	6.1%	-5.2%
Subfloor under hardwood	Subfloor OSB	15.6%	11.4%	7.8%	-7.8%

Prepared by Apex Restoration Co. using DryTrack Pro for project documentation purposes. Data, moisture readings, and notes reflect conditions observed at the time of inspection.


Bedroom Closet

Location	Material	Day 1	Day 2	Day 3	Change
Subfloor - cavity access	Subfloor OSB	21.4%	16.0%	10.5%	-10.9%
Drywall - common wall	Drywall	18.9%	13.7%	9.1%	-9.8%
Drywall - closet W	Drywall	16.2%	11.8%	7.9%	-8.3%

Drying Progress - Moisture Trend Charts


Master Bathroom

Day 1 - Day 3 | 12 readings | 4 points

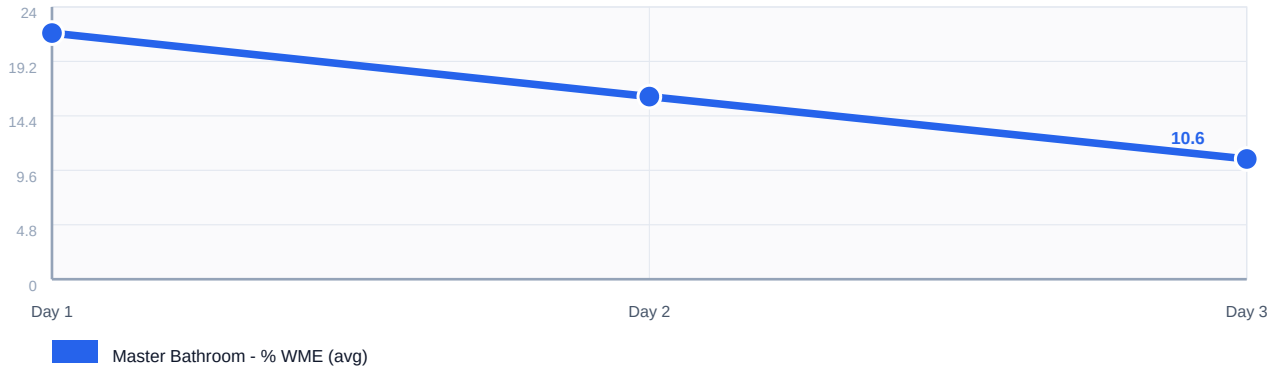


Hallway

Day 1 - Day 3 | 12 readings | 4 points

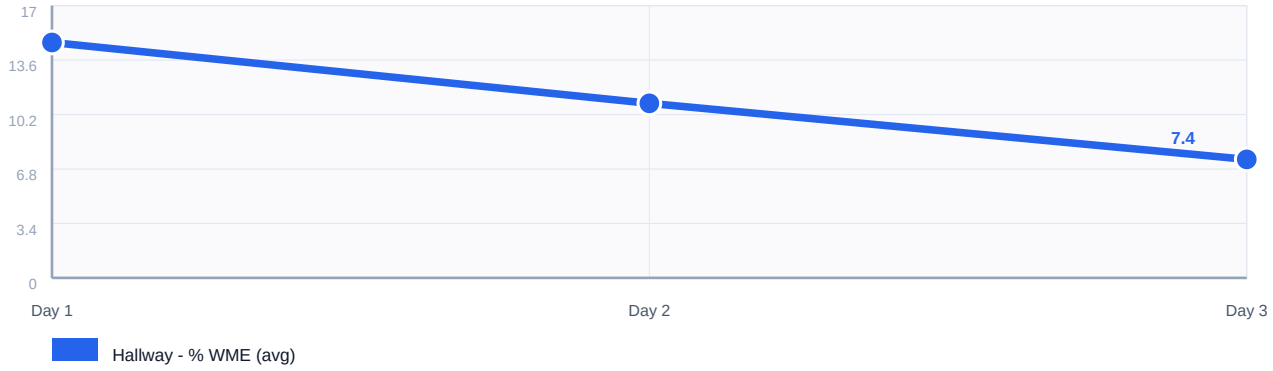

Bedroom Closet

Day 1 - Day 3 | 9 readings | 3 points

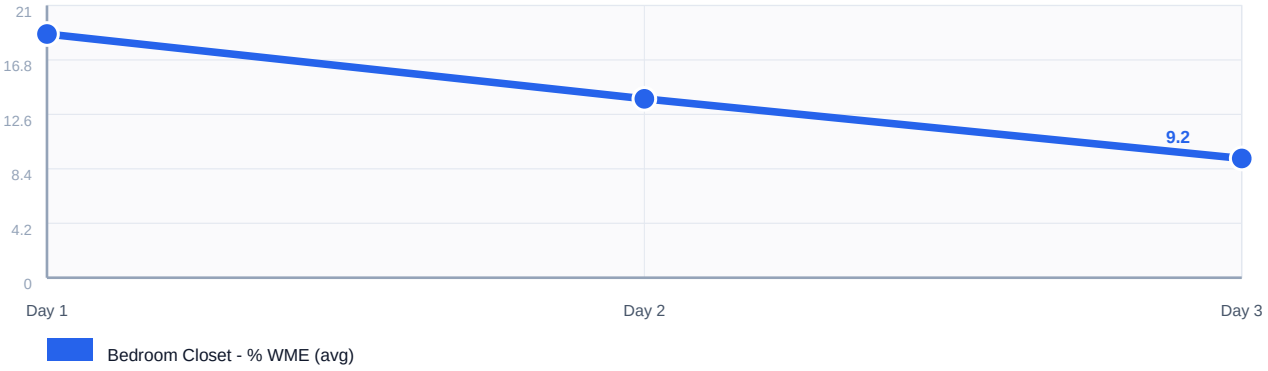

Active Equipment on Site

Type	Model	Serial	Area	Days Active	Status
Dehumidifier (LGR)	Dri-Eaz DefendAir HVE 5000	DA-5000-4418	Hallway	3	**Operational**
Dehumidifier (LGR)	Dri-Eaz DefendAir HVE 5000	DA-5000-4519	Master Bathroom	3	**Operational**
Air Mover	Dri-Eaz F600 Sidekick	F600-1181	Master Bathroom	3	**Operational**
Air Mover	Dri-Eaz F600 Sidekick	F600-1182	Master Bathroom	3	**Operational**
Air Mover	Dri-Eaz F600 Sidekick	F600-1183	Hallway	3	**Operational**
Air Mover	Dri-Eaz F600 Sidekick	F600-1184	Bedroom Closet	3	**Operational**
HEPA Air Scrubber	Dri-Eaz HEPA 500 XL	H500-0928	Hallway (neg. pressure)	3	**Operational**

Technician Notes

Day 3 | 11:00 | M. Torres

Day 3 site check. Significant improvement across all areas. Bathroom subfloor now at 12.2%, down from 24.1% on Day 1. Hallway hardwood showing good recovery - flooring joint gaps closing. Closet wall still above dry standard but trending well. Homeowner reports no new moisture intrusion. Equipment operating normally. Recommend continuing full drying program through Day 5.

Plan for Day 4 - March 24, 2026

- Continue full drying program - all 7 units to remain on site.
- Re-check all reading points across all 3 areas. Target: < 6% WME in Master Bathroom subfloor; < 5% in Bedroom Closet wall cavity.
- If Hallway flooring readings reach <= 4%, consider removing 2 air movers from that area.
- Inspect dehumidifier drain lines; clear or empty as required.
- Notify homeowner of progress and confirm anticipated Day 5 closure timeline.
- Prepare closure documentation and equipment removal checklist for Day 5 sign-off.